
## ADAPTOR DATASHEET



## 2.4MM(FEMALE)-SSMA(MALE)

## 2.4/SSMA-KJS

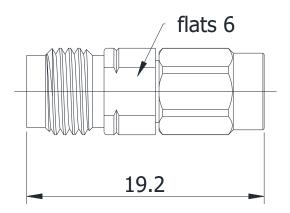

## \*Dimensions are in mm

Configuration	
Connector 1 Type	2.4mm Female
Connector 1 Impedance	50 Ohms
Connector 1 Polarity	Standard
Connector 2 Type	SSMA Male
Connector 2 Impedance	50 Ohms
Connector 2 Polarity	Standard
Connector Mount Method	None
Adapter Body Style	Straight
Frequency	DC to 40 GHz
T(-ID)	10 0F - C-+ (f CII-)
Insertion Loss (dB)	≤ 0.05 xSqt.(f_GHz)
Insertion Loss (dB) VSWR /Return Loss	≤ 0.05 xSqt.(f_GHz) 1.20 to 40 GHz
VSWR /Return Loss	1.20 to 40 GHz
VSWR /Return Loss	1.20 to 40 GHz
VSWR /Return Loss  Materials Information	1.20 to 40 GHz
VSWR /Return Loss  Materials Information  Center Contact	1.20 to 40 GHz  CuBe Gold Plated
VSWR /Return Loss  Materials Information  Center Contact  Outer Contact	1.20 to 40 GHz  CuBe Gold Plated Stainless Steel
VSWR /Return Loss  Materials Information  Center Contact  Outer Contact  Body	1.20 to 40 GHz  CuBe Gold Plated Stainless Steel Stainless Steel
VSWR /Return Loss  Materials Information  Center Contact Outer Contact  Body Dielectric	1.20 to 40 GHz  CuBe Gold Plated Stainless Steel Stainless Steel
VSWR /Return Loss  Materials Information Center Contact Outer Contact Body Dielectric  Environmental Data	1.20 to 40 GHz  CuBe Gold Plated Stainless Steel Stainless Steel PTFE&PEI

While the information has been carefully compiled to the best of our knowledge, nothing is intended as representation or warranty on our part and no statement herein shall be construed as recommendation to infringe existing patents. In the effort to improve our products, we reserve the right to make changes judged to be necessary.

Gwave Technology Inc.	
4th Floor, New Material Plaza, Yo	ngfeng Hi-Tech Base,Haidian
District, Beijing , China (100094)	www.gwave-tech.com

Tel.: +86 10 86484190 Fax: +86 10 86484190-0 email: gwave@gwave-tech.com